



Installation Instructions

Meter Pack STD
 160A outgoing 3 ph 4 wire
 CT operated meter
 NHVM160MKSTD



This unit should be installed by a qualified competent person in accordance with all relevant legislation and regulations including building regulations and wiring regulations BS7671. If in doubt contact a qualified competent person.

- Turn off all power supplying this equipment before working on or inside the equipment.
- Always use a properly rated volt-sensing device to confirm the power is off.
- Replace all devices, doors and covers before turning on the power to this equipment.
- To avoid ingress of swarf and similar material, always remove gland plates to allow cutting/slotting for cable entries to be effected remotely from the Distribution Board's Installation position.

Failure to follow these instructions could result in serious injury or death.

DO NOT USE POWER TOOL SCREWDRIVERS ON ELECTRICAL CONNECTIONS

NOTE: - The aperture of the CT is a 15.5mm wide x 30mm high overall.
Please ensure that incoming cable will pass through this before continuing.

Fitting Instruction

Remove the front plates and gland plates from the cableway and distribution board

Observe the correct primary polarity of the CT (P1 – supply to CT, P2 load from CT).

Fit CT mounting bracket and CT alongside the MCCB as shown in Fig. 1.

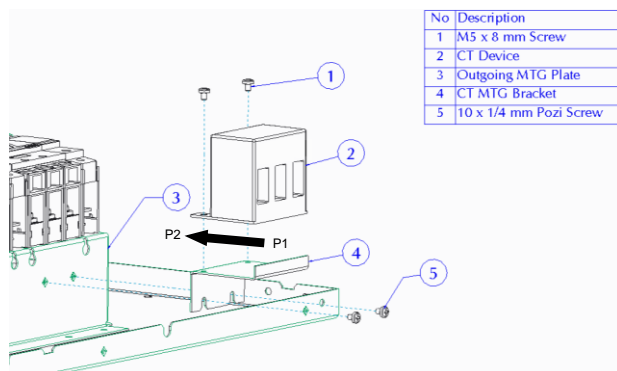


Fig. 1

Remove the knockout on the cableway to allow the meter to be mounted, ensure there are no sharp edges after removal. Refer to Fig. 2 for details.

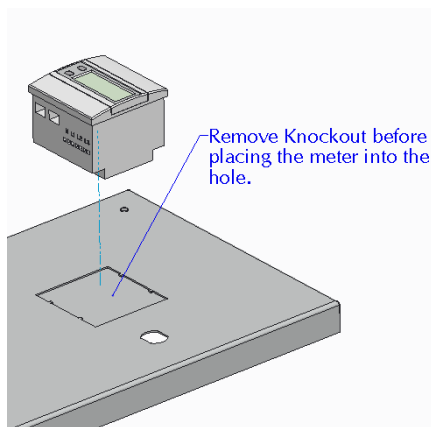


Fig. 2

Place the display unit into the exterior of the hole formed in the cableway. Ensure the orientation is correct, and gently push the display into the cableway until you hear the “clicks” of the tabs. This should indicate that the meter is fitted correctly.

Fit the 4P MCB required for the meter voltage connections by referring to leaflet in the voltage supply loom & the wiring diagram in Fig. 3 & 4. Remove the shroud from the top end of the busbar to gain access. Connect the MCB to the Busbar using the voltage supply loom kit.

VOLTAGE SUPPLY LOOM SOLD SEPERATLY CATALOGUE NO. 17VMVSLK

Wiring Instruction

Using the cable loom provided connect the meter to the MCB by referring to the wiring diagram in fig. 4. If the cables are too long cut the cable to length ensuring the cable markers remain on both ends of the cable. Connect the CT to the meter using the attached RJ11 connection. Refer to fig. 4 for wiring details.

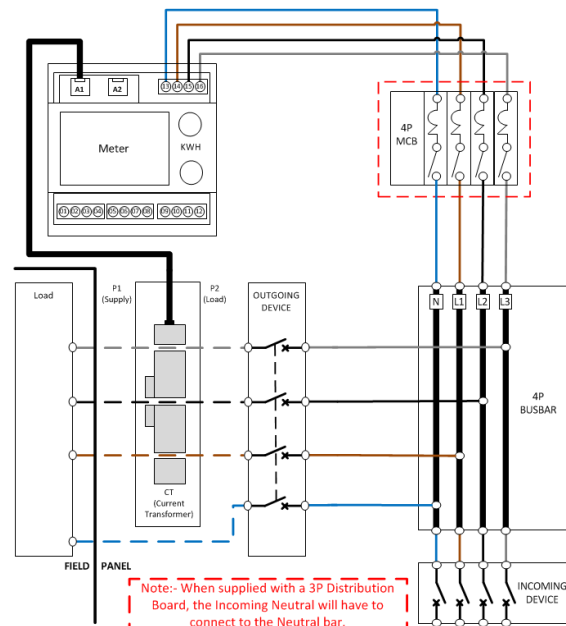


Fig. 4



Electrium Sales Limited, Walkmill Lane, Cannock, WS11 0XE
 Tel: 01543 455000 Fax: 01543 455001

Waste electrical products should not be disposed of with household waste. Please recycle where waste disposal facilities exist. Check with your retailer, wholesaler or local authority for recycling advice.



Installation Instructions

Meter Pack STD
160A outgoing 3 ph 4 wire
CT operated meter
NHVM160MKSTD



If there is more than one meter use the voltage looms provided in the kit and refer to fig. 5 for wiring details.

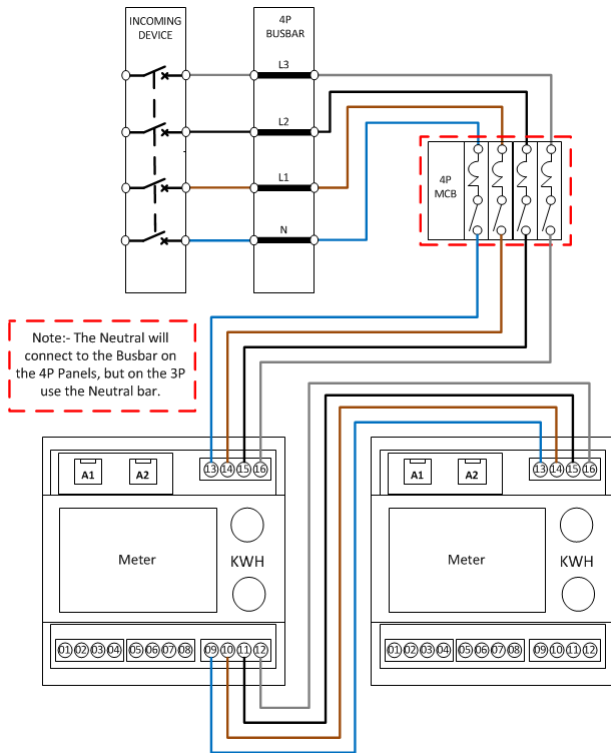


Fig. 5

Use pads and cable ties to secure cable. Fully tighten terminal cages and cable clamps to the torque as recommended in Fig.6.

Recommended Tightening Torques	
Fastener	Torque
Neutral Terminal Bar	6 Nm
Busbar End	15 Nm
MCB Device	See Manufacturers Leaflet for Recommended settings

Fig. 6

Re-fitting Instruction

Refit the gland plate. Refit the shroud to the top of the busbars over the copper connections.

Before fitting the front cover, check the tightness of **all** connections, including factory made connections.

Remove the appropriate knockout(s) in the cableway front plate and refit to box.

Meter setup Instruction

Setting up of the meter CT ratio is required for point to point meters (EM270). Refer to meter instructions for details.

Meters fitted to the left side of the busbar must be set to 3, 2, 1 phase orientation by default they are 1, 2, 3.